

PAGE: 1

PRINT DATE: 6/16/95

FAILURE MODES EFFECTS ANALYSIS (FMEA) - CRITICAL HARDWARE  
NUMBER: 05-6J-2182 -X

SUBSYSTEM NAME: EPD&amp;C MAIN PROPULSION SYSTEM

REVISION: 0 11/04/87

	PART NAME VENDOR NAME	PART NUMBER VENDOR NUMBER
LRU	: AFT LCA 1	MC450-0057-0001
LRU	: AFT LCA 2	MC450-0058-0001
LRU	: AFT LCA 3	MC450-0059-0001
SRU	: DIODE	JANTXV1N5551

## PART DATA

EXTENDED DESCRIPTION OF PART UNDER ANALYSIS:  
DIODE, BLOCKING (3 AMP), OPEN MDM, HYBRID DRIVER CONTROLLER COMMAND, LO2  
PREVALVE 1, 2 AND 3.

## REFERENCE DESIGNATORS: AV BAY 4:

P140(81)  
P140(95)

BAY 5:  
P140(64)  
P140(108)

BAY 6:  
P140(78)  
P140(64)

56V76A123-J1(37)  
54V76A121-J1(37)  
55V76A122-J1(37)

QUANTITY OF LIKE ITEMS: 9  
NINE 3 PER PREVALVE 1, 2 AND 3

## FUNCTION:

DIODE ISOLATES MANUAL SWITCH COMMAND FROM MDM, CONDUCTS MDM  
COMMAND TO HYBRID DRIVER CONTROLLER FOR CONTROL OF REDUNDANT POWER  
TO OPEN SOLENOIDS FOR LO2 PREVALVE OPERATION.

## FAILURE MODES EFFECTS ANALYSIS FMEA -- CIL FAILURE MODE

NUMBER: 05-6J-2182-02

REVISION#: 0 09/13/95

SUBSYSTEM NAME: EPD&amp;C MAIN PROPULSION SYSTEM

LRU: AFT LCA 1, 2, 3 AV BAY 4, 5, 6 DIODE BOX

CRITICALITY OF THIS

ITEM NAME: DIODE

FAILURE MODE: 1R3

FAILURE MODE:  
SHORT, END-TO-ENDMISSION PHASE: PL PRE-LAUNCH  
LD LIFT-OFFVEHICLE/PAYLOAD/KIT EFFECTIVITY: 102 COLUMBIA  
103 DISCOVERY  
104 ATLANTIS  
105 ENDEAVOURCAUSE:  
STRUCTURAL FAILURE, ELECTRICAL STRESS, PROCESSING ANOMALY,  
CONTAMINATION, MECHANICAL SHOCK, VIBRATION, THERMAL STRESS.

CRITICALITY 1/1 DURING INTACT ABORT ONLY? NO

REDUNDANCY SCREEN A) PASS  
B) FAIL  
C) PASS

## PASS/FAIL RATIONALE:

A)

B)

FAILS B SCREEN BECAUSE FAILURE OF DIODE ALONE ALLOWS FULL FUNCTION OF  
COMMAND PATH AND IS NOT READILY DETECTABLE.

C)

## - FAILURE EFFECTS -

(A) SUBSYSTEM:  
LOSS OF MDM ISOLATION FROM MANUAL SWITCH COMMAND.(B) INTERFACING SUBSYSTEM(S):  
NO EFFECT - FIRST FAILURE

FAILURE MODES EFFECTS ANALYSIS (FMEA) - CIL FAILURE MODE  
NUMBER: 05-6J-2162-02

## (C) MISSION:

NO EFFECT - FIRST FAILURE

## (D) CREW, VEHICLE, AND ELEMENT(S):

NO EFFECT - FIRST FAILURE

## (E) FUNCTIONAL CRITICALITY EFFECTS:

1RS, 4 SUCCESS PATHS. TIME FRAME - ASCENT

- 1) DIODE SHORTS END-TO-END
- 2) SERIES OPEN HDC I SHORTS TO GROUND. RESULTS IN LOSS OF REDUNDANCY FOR OPEN PREVALVE COMMAND.
- 3) PARALLEL POWER PATH FAILS "OFF" (HDC, RPC, OR DIODE). RESULTS IN LOSS OF OPEN POWER PATH TO LO2 PREVALVE. BISTABLE FEATURE MAINTAINS PREVALVE IN OPEN POSITION.
- 4) EITHER CLOSING SOLENOID FAILS "ON". RESULTS IN PREMATURE ACTUATION OF CLOSE SOLENOID.

RESULTS IN PREMATURE LO2 PREVALVE CLOSURE WHILE ENGINE IS RUNNING,  
CAUSING UNCONTAINED ENGINE DAMAGE DUE TO STARVATION CUTOFF.  
FIRE/EXPLOSION IN AFT COMPARTMENT, LOSS OF CREW/VEHICLE.

---

**-DISPOSITION RATIONALE-**

---

## (A) DESIGN:

REFER TO APPENDIX F, ITEM NO. 4 - DIODE.

## (B) TEST:

REFER TO APPENDIX F, ITEM NO. 4 - DIODE.

## GROUND TURNAROUND TEST

MDM COMMAND REDUNDANCY, V41AS0.360B, F, H, J; 400B, F, H, J; 420B, F, H, J. EVERY FLIGHT.

## (C) INSPECTION:

REFER TO APPENDIX F, ITEM NO. 4 - DIODE.

## (D) FAILURE HISTORY:

REFER TO APPENDIX F, ITEM NO. 4 - DIODE.

## (E) OPERATIONAL USE:

NO CREW ACTION CAN BE TAKEN.

FAILURE MODES EFFECTS ANALYSIS (FMEA) - CIL FAILURE MODE  
NUMBER: 05-8J-2182-02

- APPROVALS -

PAE MANAGER : D. F. MIKULA  
 PRODUCT ASSURANCE ENGR : M. R. MILLER  
 DESIGN ENGINEERING : J. L. PECK  
 NASA SSMA :  
 NASA SUBSYSTEM MANAGER :  
 JSC MOD :  
 SSE :

*D.F. Mikula 9/19/95*  
*M.R. Miller 9/19/95*  
*J.L. Peck 9/19/95*  
*Patricia C. Xianweng 9/20/95*