

CRITICAL ITEMS LIST

PROJECT: SRMS

ASS'Y NOMENCLATURE: ROTATIONAL HAND CONTROLLER

SYSTEM: D&C SUBSYSTEM

ASS'Y P/N: 51155E117

SHEET: 1

PMA REF.	REV.	NAME, QTY, & DRAWING REF. DESIGNATION	FAILURE MODE AND CAUSE	FAILURE EFFECT ON END ITEM	HOWR / FUNC. I/I CRITICALITY RATIONALE FOR ACCEPTANCE
1460	2	ROTATIONAL HAND CONTROLLER QTY-1 SPAR P/N 51155E117	<p>MODE: UNCOMMANDED OUTPUT IN ANY ONE AXIS.</p> <p>CAUSE(S):</p> <p>(1) RMC DEMODULATOR TRANSISTOR COLLECTOR FAILS OPEN.</p> <p>(2) RMC DEMODULATOR TRANSISTOR B-E JUNCTION FAILS SHORTED.</p> <p>(3) RETURN SPRING FRACTURES.</p>	<p>CAUSE (1) ONE AXIS HAS PERMANENT RATE COMMAND OF 2/3 OF MAX. ARM MAY TAKE UNEXPECTED TRAJECTORY.</p> <p>CAUSE (2) SAME AS ABOVE RATE COMMAND OF 1/3 OF MAX.</p> <p>CAUSE (3) ONE AXIS HAS PERMANENT RATE COMMAND AT LAST POSITION ARM MAY TAKE UNEXPECTED TRAJECTORY.</p> <p>WORST CASE UNEXPECTED MOTION, 6 JOINT RUNAWAY, UNANNUNCIATED, CREW ACTION REQ.</p> <p>REDUNDANT PATHS REMAINING</p> <p>N/A</p>	<p>DESIGN FEATURES</p> <p>-----</p> <p>THREE IDENTICAL CIRCUITS PROVIDE SIGNAL DEMODULATION FOR EACH OF THE THREE TRANSDUCERS.</p> <p>IN EACH CIRCUIT, TWO TRANSISTORS ARE ALTERNATELY SWITCHED BY THE OUTPUT OF A TRANSFORMER WHICH IS DRIVEN BY 20 VAC, 1500HZ. THE SWITCHING ACTION OF THE TRANSISTORS RESULTS IN PHASE-SENSITIVE RECTIFICATION OF THE TRANSDUCER OUTPUT. THE RECTIFIED OUTPUT IS FILTERED, AND SCALED BY AN OPERATIONAL AMPLIFIER. ONE TRANSFORMER PROVIDES THE SWITCHING COMMANDS FOR ALL THREE CIRCUITS.</p> <p>TRANSISTORS ARE 2N2432A TYPE. OP-AMPS ARE TYPE LM101A.</p> <p>EEC PARTS HAVE BEEN SELECTED AND CONTROLLED IN ACCORDANCE WITH SPAR-RMS-PA.003. THIS DOCUMENT DEFINES THE PROGRAM REQUIREMENTS FOR MONITORING AND CONTROLLING EEC PARTS. THE REQUIREMENTS INCLUDE PARTS SELECTION TO AT LEAST "ESTABLISHED RELIABILITY" LEVELS, AND ADEQUATE DERATING OF PART STRESS LEVELS. PROCEDURES AND ACTIVITIES ARE SPECIFIED TO ENSURE AT LEAST EQUIVALENT QUALITY FOR NONSTANDARD AND IRREGULAR PARTS. RELIABILITY ANALYSIS HAS CONFIRMED NO PARTS WITH GENERICALLY HIGH FAILURE RATES. AEROSPACE DESIGN STANDARDS FOR DETAILING ELECTRONIC PARTS PACKAGING, MOUNTING AND STRUCTURAL/MECHANICAL/INTEGRITY OF ASSEMBLIES ARE APPLIED. SUCH DESIGN HAS BEEN REVIEWED AND FOUND SATISFACTORY THROUGH THE DESIGN AUDIT PROCESS, INCLUDING THE USE OF RELIABILITY, MAINTAINABILITY AND SAFETY CHECKLISTS. MATERIAL SELECTION AND USAGE CONFORMS TO SPAR-SC.168 WHICH IS EQUIVALENT TO THE NASA MATERIALS USAGE REQUIREMENTS. WORST CASE ANALYSIS HAS BEEN CONDUCTED TO ENSURE THAT PERFORMANCE CAN BE MET UNDER WORST CASE TEMPERATURE AND AGING EFFECTS. EEC PARTS STRESS ANALYSIS HAS BEEN COMPLETED AND CONFIRMS THAT THE PARTS MEET THE DERATING REQUIREMENTS.</p> <p>PRINTED CIRCUIT BOARD DESIGNS HAVE BEEN REVIEWED TO ENSURE ADEQUATE CIRCUIT PATH WIDTH AND SEPARATION AND TO CONFIRM APPROPRIATE DIMENSIONS OF CIRCUIT SOLDER PADS AND OF COMPONENT HOLE PROVISIONS.</p> <p>PARTS MOUNTING METHODS ARE CONTROLLED IN ACCORDANCE WITH NSFC-STD-136 AND CAE P093489. THESE DOCUMENTS REQUIRE APPROVED-MOUNTING METHODS, STRESS RELIEF, AND COMPONENT SECURITY.</p> <p>WHERE APPLICABLE, DESIGN DRAWINGS AND DOCUMENTATION GIVE CLEAR IDENTIFICATION OF HANDLING PRECAUTIONS FOR ESD SENSITIVE PARTS.</p> <p>BOARD ASSEMBLY DRAWINGS INCLUDE THE REQUIREMENT FOR SOLDERING STANDARDS IN ACCORDANCE WITH MHB 5300.4(1A) AND JSC 08B00A.</p> <p>PROCESSING OF ADDRESS DECODING IS PERFORMED USING 'A' TYPE CMOS LOGIC DEVICES. INPUT DATA IS BUFFERED BY A COMPLEMENTARY TRANSISTOR STAGE. THE CMOS LOGIC CIRCUITS ARE OF THE GENERIC TYPE SERIES "4000A". THE COMPLEMENTARY TRANSISTORS ARE 2N2222A AND 2N2907A.</p>

PREPARED BY: HWG

SUPERSEDING DATE: 06 OCT 87

APPROVED BY

DATE: _____

CRITICAL ITEMS LIST

PROJECT: SRMS
 ASS'Y NOMENCLATURE: ROTATIONAL HAND CONTROLLER

SYSTEM: D&C SUBSYSTEM
 ASS'Y P/N: 51155E117

SHEET: 2

P/N REF.	REV.	NAME, QTY, & DRAWING REF. DESIGNATION	FAILURE MODE AND CAUSE	FAILURE EFFECT OR END ITEM	HDWR / FUNC. I/I CRITICALITY	RATIONALE FOR ACCEPTANCE
1460	2	ROTATIONAL HAND CONTROLLER QTY-1 SPAR P/N 51155E117	MODE: UNCOMMANDED OUTPUT IN ANY ONE AXIS. CAUSE(S): (1) RMC DEMODULATOR TRANSISTOR COLLECTOR FAILS OPEN. (2) RMC DEMODULATOR TRANSISTOR B-E JUNCTION FAILS SHORTED. (3) RETURN SPRING FRACTURES.	CAUSE (1) ONE AXIS HAS PERMANENT RATE COMMAND OF 2/3 OF MAX. ARM MAY TAKE UNEXPECTED TRAJECTORY. CAUSE (2) SAME AS ABOVE RATE COMMAND OF 1/3 OF MAX. CAUSE (3) ONE AXIS HAS PERMANENT RATE COMMAND AT LAST POSITION ARM MAY TAKE UNEXPECTED TRAJECTORY. WORST CASE ----- UNEXPECTED MOTION, & JOINT RUNAWAY, UNANNOUNCED, CREW ACTION REQ. REDUNDANT PATHS REMAINING ----- N/A		

PREPARED BY: WHS

SUPERSEDING DATE: 06 OCT 87

APPROVED BY: _____

DATE: _____

CRITICAL ITEMS LIST

PROJECT: SRMS
 ASS'Y NOMENCLATURE: ROTATIONAL HAND CONTROLLER

SYSTEM: D&C SUBSYSTEM
 ASS'Y P/N: 51155E117

SHEET: 3

P/N & REF.	REV.	NAME, QTY & DRAWING REF. DESIGNATION	FAILURE MODE AND CAUSE	FAILURE EFFECT OR END ITEM	HOUR / FUNC. I/I CRITICALITY	RATIONALE FOR ACCEPTANCE
1460	2	ROTATIONAL HAND CONTROLLER QTY-1 SPAR P/N 51155E117	<p>MODE: UNCOMMANDED: OUTPUT IN ANY ONE AXIS.</p> <p>CAUSE(S): (1) RMC DEMODULATOR TRANSISTOR COLLECTOR FAILS OPEN. (2) RMC DEMODULATOR TRANSISTOR B-E JUNCTION FAILS SHORTED. (3) RETURN SPRING FRACTURES.</p>	<p>CAUSE (1) ONE AXIS HAS PERMANENT RATE COMMAND OF 2/3 OF MAX. ARM MAY TAKE UNEXPECTED TRAJECTORY.</p> <p>CAUSE (2) SAME AS ABOVE RATE COMMAND OF 1/3 OF MAX.</p> <p>CAUSE (3) ONE AXIS HAS PERMANENT RATE COMMAND AT LAST POSITION. ARM MAY TAKE UNEXPECTED TRAJECTORY.</p> <p>WORST CASE UNEXPECTED MOTION. 6 JOINT RUNAWAY. UNANNUNCIATED. CREW ACTION REQ.</p> <p>REDUNDANT PATHS REMAINING</p> <p>N/A</p>		<p>ACCEPTANCE TESTS</p> <p>THE RHC IS SUBJECTED TO THE FOLLOWING ACCEPTANCE ENVIRONMENTAL TESTING AS AN SRU.</p> <p>O VIBRATION: LEVEL AND DURATION REFERENCE TABLE 1</p> <p>O THERMAL: +120 DEGREES F TO 20 DEGREES F (12 HRS PER CYCLE) 2 CYCLES TOTAL.</p> <p>THE RHC IS TESTED AS PART OF THE D&C SUBSYSTEM; WHICH CONSIST OF D&C PANEL, THC AND RHC; PER TP 347.</p> <p>THE TOTAL D&C SUBSYSTEM UNDERGOES RMS SYSTEM TESTING, (TP 510 RMS STRONGBACK, AND TP552 FLAT FLOOR TESTS) WHICH VERIFIES THE ABSENCE OF THE FAILURE MODE.</p> <p>QUALIFICATIONS TESTS</p> <p>THE RHC IS CERTIFIED BY SIMILARITY TO THE ORBITER USED RHC EXCEPT FOR FINGER OPERATED SWITCHES. THE BASIC DIFFERENCES IS THAT THE ORBITER RHC IS TRIPLE REDUNDANT AND THE RMS RHC IS SINGLE STRING.</p> <p>FLIGHT CHECKOUT</p> <p>PDRS OPS CHECKLIST (ALL VEHICLES) JSC 16987</p>

PREPARED BY: PHMC

SUPERSEDING DATE: 06 OCT 87

APPROVED BY:

RMS/D&C - 360

ITE: _____

CRITICAL ITEMS LIST

PROJECT: SRMS

ASS'Y NOMENCLATURE: ROTATIONAL HAND CONTROLLER

SYSTEM: D&C SUBSYSTEM

ASS'Y P/N: 51155C117

SHEET: 4

ITEM REF.	REV.	NAME, QTY & DRAWING REF. DESIGNATION	FAILURE MODE AND CAUSE	FAILURE EFFECT ON END ITEM	HDMR / FUNC. I/I CRITICALITY	RATIONALE FOR ACCEPTANCE
1460	2	ROTATIONAL HAND CONTROLLER QTY-1 SPAR P/N 51155C117	<p>MODE: UNCOMMANDED OUTPUT IN ANY ONE AXIS.</p> <p>CAUSE(S): (1) RMC DEMODULATOR TRANSISTOR COLLECTOR FAILS OPEN. (2) RMC DEMODULATOR TRANSISTOR B-E JUNCTION FAILS SHORTED. (3) RETURN SPRING FRACTURES.</p>	<p>CAUSE (1) ONE AXIS HAS PERMANENT RATE COMMAND OF 2/3 OF MAX. ARM MAY TAKE UNEXPECTED TRAJECTORY.</p> <p>CAUSE (2) SAME AS ABOVE RATE COMMAND OF 1/3 OF MAX.</p> <p>CAUSE (3) ONE AXIS HAS PERMANENT RATE COMMAND AT LAST POSITION ARM MAY TAKE UNEXPECTED TRAJECTORY.</p> <p>WORST CASE UNEXPECTED MOTION, & JOINT RUNAWAY, UNANNUNCIATED, CREW ACTION REQ.</p> <p>REDUNDANT PATHS REMAINING</p> <p>N/A</p>	<p>QA/INSPECTIONS</p>	<p>EEE PARTS INSPECTION IS PERFORMED AS REQUIRED BY SPAR-RMS-PA.003. EACH EEE PART IS QUALIFIED AT THE PART LEVEL TO THE REQUIREMENTS OF THE APPLICABLE SPECIFICATION. ALL EEE PARTS ARE 100% SCREENED AND BURNED IN, AS A MINIMUM, AS REQUIRED BY SPAR-RMS-PA.003, BY THE SUPPLIER. ADDITIONALLY, EEE PARTS ARE 100% RE-SCREENED IN ACCORDANCE WITH REQUIREMENTS, BY AN INDEPENDENT SPAR APPROVED TESTING FACILITY. OPA IS PERFORMED AS REQUIRED BY PA.003 ON A RANDOMLY SELECTED 5K OF PARTS, MAXIMUM 5 PIECES, MINIMUM 3 PIECES FOR EACH LOT NUMBER/DATE CODE OF PARTS RECEIVED.</p> <p>WIRE IS PROCURED TO SPECIFICATION MIL-W-22759 OR MIL-W-81381 AND INSPECTED AND TESTED TO NASA JSC0000 STANDARD NUMBER 95A.</p> <p>RECEIVING INSPECTION VERIFIES THAT ALL PARTS RECEIVED ARE AS IDENTIFIED IN THE PROCUREMENT DOCUMENTS, THAT NO PHYSICAL DAMAGE TO PARTS HAS OCCURRED DURING SHIPMENT AND THAT APPROPRIATE DATA HAS BEEN RECEIVED WHICH PROVIDES ADEQUATE TRACEABILITY INFORMATION AND IDENTIFIES ACCEPTABLE PARTS.</p> <p>THE TRANSDUCER ASSY CONSISTING OF A TRANSDUCER, DRY LUBE BEARINGS AND SPRINGS ETC. ARE BOUGHT OUT PARTS AS REQUIRED BY CAC SPEC PSB7786. INSPECTIONS ARE PERFORMED BY THE SUPPLIER CLIFTON PRECISION TO VERIFY THAT EACH MANUFACTURING, ASSEMBLY AND TEST OPERATION IS SATISFACTORILY COMPLETED.</p> <p>PARTS ARE INSPECTED THROUGHOUT MANUFACTURE AND ASSEMBLY AS APPROPRIATE TO THE MANUFACTURING STAGE COMPLETED. THESE INSPECTIONS INCLUDE:</p> <p>PRINTED CIRCUIT BOARD INSPECTION FOR TRACK SEPARATION, DAMAGE AND ADEQUACY OF PLATED THROUGH HOLES.</p> <p>COMPONENT MOUNTING INSPECTION FOR CORRECT SOLDERING, WIRE LOOPING, STRAPPING, ETC. OPERATORS AND INSPECTORS ARE TRAINED AND CERTIFIED TO NASA RHB 5300.4(3A) STANDARD, AS MODIFIED BY JSC 08900A.</p> <p>CONFORMAL COATING INSPECTION FOR ADEQUATE PROCESSING IS PERFORMED USING ULTRAVIOLET LIGHT TECHNIQUES.</p> <p>POST P.C. BD. INSTALLATION INSPECTION, WORKMANSHIP & CLEANLINESS (HONEYWELL/GOVERNMENT REP. - MANDATORY INSPECTION POINT)</p> <p>P.C. BD. INSTALLATION INSPECTION, CHECK FOR CORRECT BOARD INSTALLATION, ALIGNMENT OF BOARDS, PROPER CONNECTOR CONTACT RATING, WIRE ROUTING, STRAPPING OF WIRES ETC.,</p> <p>PRE-CLOSURE INSPECTION, WORKMANSHIP AND CLEANLINESS (CAC/GOVERNMENT REP. - MANDATORY INSPECTION POINT)</p> <p>PRE-ACCEPTANCE TEST INSPECTION, WHICH INCLUDES AN AUDIT OF LOWER TIER INSPECTION COMPLETION, AS BUILT CONFIGURATION VERIFICATION TO AS DESIGN ETC., (MANDATORY INSPECTION POINT).</p>

PREPARED BY: HWG

SUPERSEDING DATE: 06 OCT 87

APPROVED BY: _____

DATE: _____

CRITICAL ITEMS LIST

PROJECT: SRMS
 ASS'Y NOMENCLATURE: ROTATIONAL HAND CONTROLLER

SYSTEM: D&C SUBSYSTEM
 ASS'Y P/N: 51155E117 SHEET: 5

P/CA REF.	REV.	NAME, QTY & DRAWING REF. DESIGNATION	FAILURE MODE AND CAUSE	FAILURE EFFECT ON END ITEM	HOUR / FUNC. 1/1 CRITICALITY	RATIONALE FOR ACCEPTANCE
1460	2	ROTATIONAL HAND CONTROLLER QTY-1 SPAR P/N 51155E117	<p>MODE: UNCOMMANDED OUTPUT IN ANY ONE AXIS.</p> <p>CAUSE(S): (1) RMC DEMODULATOR TRANSISTOR COLLECTOR FAILS OPEN.</p> <p>(2) RMC DEMODULATOR TRANSISTOR B-E JUNCTION FAILS SHORTED.</p> <p>(3) RETURN SPRING FRACTURES.</p>	<p>CAUSE (1) ONE AXIS HAS PERMANENT RATE COMMAND OF 2/3 OF MAX. ARM MAY TAKE UNEXPECTED TRAJECTORY.</p> <p>CAUSE (2) SAME AS ABOVE RATE COMMAND OF 1/3 OF MAX.</p> <p>CAUSE (3) ONE AXIS HAS PERMANENT RATE COMMAND AT LAST POSITION ARM MAY TAKE UNEXPECTED TRAJECTORY.</p> <p>WORST CASE ----- UNEXPECTED MOTION. 6 JOINT RUNAWAY. UNANNUNCIATED. CREW ACTION REQ.</p> <p>REDUNDANT PATHS REMAINING ----- N/A</p>		<p>A TEST READINESS REVIEW (TRR) WHICH INCLUDES VERIFICATION OF TEST PERSONNEL, TEST DOCUMENTS, TEST EQUIPMENT CALIBRATION/ VALIDATION STATUS AND HARDWARE CONFIGURATION IS CONVENED BY QUALITY ASSURANCE IN CONJUNCTION WITH ENGINEERING, RELIABILITY, CONFIGURATION CONTROL, SUPPLIER AS APPLICABLE, AND THE GOVERNMENT REPRESENTATIVE, PRIOR TO THE START OF ANY FORMAL TESTING (ACCEPTANCE OR QUALIFICATION).</p> <p>ACCEPTANCE TESTING (ATP) INCLUDES, AMBIENT, VIBRATION AND THERMAL TESTING (CAE/GOVERNMENT REP. - MANDATORY INSPECTION POINT)</p> <p>INTEGRATION OF D&C PANEL, RMC, TMC AND RCIU, INSPECTIONS ARE PERFORMED AT EACH STAGE OF INTEGRATION, WHICH INCLUDES GROUNDING CHECKS, INTER CONNECT CABLE VERIFICATION, CONNECTOR INSPECTION FOR BENT OR PUSHBACK CONTACTS ETC.</p> <p>SUB-SYSTEM PERFORMANCE TESTING (ATP), INCLUDES AN AMBIENT PERFORMANCE TEST. (MANDATORY INSPECTION POINT).</p> <p>SRMS SYSTEMS INTEGRATION, THE INTEGRATION OF MECHANICAL ARM SUBASSEMBLIES AND THE FLIGHT CABIN EQUIPMENT TO FORM THE SRMS. INSPECTIONS ARE PERFORMED AT EACH PHASE OF INTEGRATION WHICH INCLUDES GROUNDING CHECKS, THRU WIRING CHECKS, WIRING ROUTING, INTERFACE CONNECTORS FOR BENT OR PUSH BACK CONTACTS ETC.</p> <p>SRMS SYSTEMS TESTING - STRONGBACK AND FLAT FLOOR AMBIENT PERFORMANCE TEST. (SPAR/GOVERNMENT REP. - MANDATORY INSPECTION POINT)</p>

CRITICAL ITEMS LIST

PROJECT: SRMS
 ASS'Y NOMENCLATURE: ROTATIONAL HAND CONTROLLER

SYSTEM: D&C SUBSYSTEM
 ASS'Y P/N: 51155E117

SHEET: 6

P/N REF.	REV.	NAME, QTY & DRAWING REF. DESIGNATION	FAILURE MODE AND CAUSE	FAILURE EFFECT ON END ITEM	HOUR / FUNC. I/I CRITICALITY	RATIONALE FOR ACCEPTANCE
1460	2	ROTATIONAL HAND CONTROLLER QTY-1 SPAR P/N 51155E117	MODE: UNCOMMANDED OUTPUT IN ANY ONE AXIS. CAUSE(S): (1) RHC DEMODULATOR TRANSISTOR COLLECTOR FAILS OPEN. (2) RHC DEMODULATOR TRANSISTOR B-C JUNCTION FAILS SHORTED. (3) RETURN SPRING FRACTURES.	CAUSE (1) ONE AXIS HAS PERMANENT RATE COMMAND OF 2/3 OF MAX. ARM MAY TAKE UNEXPECTED TRAJECTORY. CAUSE (2) SAME AS ABOVE RATE COMMAND OF 1/3 OF MAX. CAUSE (3) ONE AXIS HAS PERMANENT RATE COMMAND AT LAST POSITION ARM MAY TAKE UNEXPECTED TRAJECTORY. WORST CASE UNEXPECTED MOTION, 6 JOINT RUNAWAY, UNANNUNCIATED, CREW ACTION REQ. REDUNDANT PATHS REMAINING ----- N/A	FAILURE HISTORY ----- THERE HAVE BEEN NO FAILURES ASSOCIATED WITH THIS FAILURE MODE ON THE SRMS PROGRAM. NO EEE PARTS FAILURES HAVE OCCURRED SUBSEQUENT TO ASSEMBLY OF PARTS. DURING INITIAL ENI TESTING, THE RHC WAS FOUND TO BE SUSCEPTIBLE TO RADIATED EMISSIONS RESULTING IN UNCOMMANDED OUTPUTS IN EACH AXIS. THE PROBLEM WAS RESOLVED BY REDESIGN OF THE ROCKWELL SUPPLIED INTERCONNECT CABLE BETWEEN RHC AND THE D&C PANEL. THIS CABLE, P9584(P) TO P471(S), HAS A DOUBLE SHIELD SYSTEM, WITH 160 DEGREE SHIELD CONTACT AT EACH CONNECTOR.	

PREPARED BY: NWC

SUPERSEDING DATE: 06 OCT 87

APPROVED BY: _____

DATE: _____

CRITICAL ITEMS LIST

PROJECT: SRMS
 ASS'Y NOMENCLATURE: ROTATIONAL HAND CONTROLLER

SYSTEM: D&C SUBSYSTEM
 ASS'Y P/N: S1155E117

SHEET: 2

P/N REF.	REV.	NAME, QTY & DRAWING REF. DESIGNATION	FAILURE MODE AND CAUSE	FAILURE EFFECT ON END ITEM	HDMR / FUNC. I/I CRITICALITY	RATIONALE FOR ACCEPTANCE
1460	2	ROTATIONAL HAND CONTROLLER QTY-1 SPAR P/N S1155E117	<p>MODE: UNCOMMANDED OUTPUT IN ANY ONE AXIS.</p> <p>CAUSE(S): (1) RMC DEMODULATOR TRANSISTOR COLLECTOR FAILS OPEN.</p> <p>(2) RMC DEMODULATOR TRANSISTOR B-E JUNCTION FAILS SHORTED.</p> <p>(3) RETURN SPRING FRACTURES.</p>	<p>CAUSE (1) ONE AXIS HAS PERMANENT RATE COMMAND OF 2/3 OF MAX. ARM MAY TAKE UNEXPECTED TRAJECTORY.</p> <p>CAUSE (2) SAME AS ABOVE RATE COMMAND OF 1/3 OF MAX.</p> <p>CAUSE (3) ONE AXIS HAS PERMANENT RATE COMMAND AT LAST POSITION ARM MAY TAKE UNEXPECTED TRAJECTORY.</p> <p>WORST CASE ----- UNEXPECTED MOTION. 6 JOINT RUNAWAY. UNANNOUNCIATED. CREW ACTION REQ.</p> <p>REDUNDANT PATHS REMAINING ----- N/A</p>		<p>OPERATIONAL EFFECTS ----- ARM DOES NOT RESPOND PROPERLY TO COMMANDS OR DRIVES WITHOUT COMMAND. WHEN THE COMMAND IS REMOVED, THE ARM CONTINUES TO DRIVE.</p> <p>CREW ACTION ----- APPLY BRAKES.</p> <p>CREW TRAINING ----- THE CREW WILL BE TRAINED TO ALWAYS OBSERVE WHETHER THE ARM IS RESPONDING PROPERLY TO COMMANDS. IF IT ISN'T, APPLY BRAKES.</p> <p>MISSION CONSTRAINT ----- OPERATE UNDER VERNIER RATES WITHIN 10 FT OF STRUCTURE. THE OPERATOR MUST BE ABLE TO DETECT THAT THE ARM IS RESPONDING PROPERLY TO COMMANDS VIA WINDOW AND/OR CCTV VIEWS DURING ALL ARM OPERATIONS.</p> <p>SCREEN FAILURES ----- N/A</p> <p>ORRSO OFFLINE ----- WITH THE RMC IN THE NULL POSITION VERIFY VOLTAGES AT RMC OUTPUT IN ALL AXES</p> <p>ORRSO ONLINE INSTALLATION ----- NONE</p> <p>ORRSO ONLINE TURNAROUND ----- WITH THE RMC IN THE NULL POSITION VERIFY BIT COUNT IN ALL AXES</p>

PREPARED BY: MHG

SUPERSEDING DATE: 06 OCT 97

APPROVED BY: